E-mail: megacon@firma.tele.dk

## Active power transducer for three phase, four wire, unbalanced loads with two analogue outputs


## **FEATURES**

The MC2W4 is a AC measuring converter with two independent output signals.

MC2W4 $\underline{C}$  can provide two outputs of 10mA maximum each (2 x 10mA) or 1 x 20mA(O/P2).

MC2W4D can provide two outputs, one of 10mA and one of 20mA maximum (O/P:1 x 10mA, + O/P2: 1 x 20mA).

A third variant is available with a pulsed kilowatthour output designated MC2W4P – see separate datasheet.

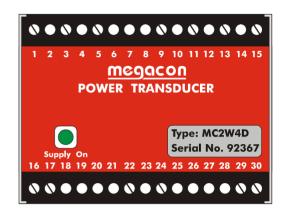


A green "Supply On" LED indicates the auxiliary supply is present.

The voltage inputs can be connected directly to systems up to 440V or calibrated for voltage transformer (V.T.) inputs. The current inputs can accept standard 1A or 5A secondary current transformer (C.T.) inputs.

The outputs are true calorimetric values proportional to the level and direction of flow of active power. They are designed for use on three phase, four wire systems with balanced or unbalanced loads.

The outputs are protected against short circuit or open circuit conditions and can be directly added or subtracted with other Megacon transducer outputs.

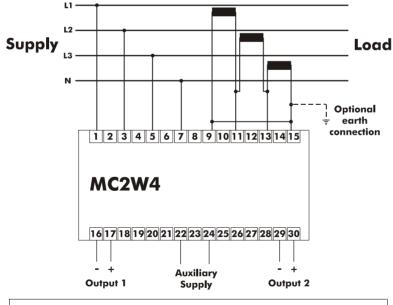

The use of screened cable is recommended for the output signals.

The negatives of the output signals MUST NOT be earthed.

Auxiliary Supply 100-120V, 200-240, 380-440V AC 18-36V, 36-72V DC Nominal +/- 10%

Current Input /1A or /5A secondary C.T. Class 1 recommended

Voltage Input up to 440V direct or via voltage transformer (V.T.)

Accuracy Class 1 between 30 to 120%In

Output – MC2W4C

Maximum combined output : 20mA

Typical 2 x 1/0/10mA

Or 1 x 4/20mA

Output – MC2W4D

Maximum combined output: 30mA

Typical 1 x –1/0/10mA

Typical 1 x -1/0/10mA 1 x 4./20mA

...

Auxiliary voltage : Kilowatt range
System voltage : Output 1
C.T. ratio : Output 2

The MEGACON policy is one of continuous improvement, consequently equipment supplied may vary in detail from this publication



**ORDERING** 

**INFORMATION**